

Attn:

VELUX America LLC
450 Old Brickyard Road
P.O. Box 5001
Greenwood, SC 29648-5001

864-941-5360 Phone
864-941-4870 Fax
veluxusa.com

Your reference

Our reference
V-USA-1-0-10

Date

Subject: VELUX® SKYLIGHT REPLACEMENT CLADDING PARTS

To whom it may concern,

Hailstorms occur frequently throughout the United States where VELUX® residential skylights are installed. The most frequent damage experienced by VELUX skylights during hailstorms is damage to the aluminum cladding covers from hailstone impacts. Larger hailstones can result in unseen damage to the primary weather seal securing the glass to the aluminum cladding. Therefore, replace the entire skylight anytime the skylight has been damaged by hailstones larger than 2" in diameter. Anytime there is hail damage to the cladding sealed directly to the skylight glazing, replace the skylight as the primary weather seal is likely compromised. See photo at right for hail damage to cladding. This primary weather seal is an adhesive sealant applied in the factory which cannot be repaired or re-applied in the field. Replace the existing flashing anytime a new skylight is installed or whenever the roof is replaced around an existing skylight. Reusing existing flashings requires the flashing components to be removed resulting in nail holes throughout the flashing and reinstalled without the use of proper installation instructions. Reusing existing flashing often results in future roof leaks around the flashing. VELUX offers the below guidance when servicing cosmetic damage to VELUX skylight cladding after a hail event.

**FS Model**

VELUX skylight and roof window models with available replacement claddings: FS skylights (FS A21) made from January 2010 to the present: Frame cladding covers only, E-Class EF, E-Class EV, and E-Class EVMS, GGL/GPL made from 2000 to the present (GGL/GPL V21 and GGL/GPL V22), GGU/GPU made from 2000 to the present (GGU/GPU V21 and GGU/GPU V22), GDL made from 2000 to present (GDL V21 and GDL V22), GXU (GXU V22).

VELUX venting skylight models that require a complete replacement sash if the sash cladding is damaged: Models VS, VSE, VCM, and VCE made from January 2010 to the present, Models VSS and VCS (All A21 series).

VELUX skylight models without replacement claddings and replacement of the entire skylight is required: FCM, FS skylights made prior to 2010 (FS M82, FS M85, FS M87, FS M95, and FS H04), FS made from January 2010 to the present: exception frame cladding covers only (FS A21), FSF, QPF, TPS, VS made prior to January 2010 (VS M84, VS M87,

After Sales Service
V-USA-1-0-10
Page 2

VS M96, VS M98, VS M2001, VS M2003, VS H04), VCM and VCE made prior to 2010 (VCM M05 and VCE M05), CMD, CMDA, SFRD, SFDA, SFHD, SFHG, GGL made prior to 2000 (GGL VES), GPL made prior to 2000 (GPL VES), GDL made prior to 2000 (GDL VES).

VELUX does not offer replacement flashings or flashing components for all skylight flashings made prior to 2010.

Removal and replacement of skylights and/or flashings requires surrounding shingles/tiles to be removed and replaced to ensure proper installation.

VELUX replacement skylight models that are provided with shades as a standard component: FS, VS, VSE, VSS, FCM, VCM, VCE, VCS, and QPF. (These models without shades are considered custom skylights offered at a higher price and maybe subject to minimum order quantities.)

VELUX may, at its own discretion, discontinue a replacement part at any time without prior written notification. Refer to VELUX skylight model pictorial attachment for assistance identifying skylight models.

With kind regards,



John Lawton
VELUX Skylights
Manager, Skylight Global Product Management

Skylight Deck Mount Models - Pictorial

FS M82 / FS M85 / FS M87**Mfg 12/1982 – 03/1995**

No replacement cladding parts.
Skylight replacement only.
Distinguished by exterior screws
through the top of the cladding
covers

**FS M95****Mfg 04/1995 – 05/2004**

No replacement cladding parts.
Skylight replacement only.



FS H04**Mfg 05/2004 – 12/2009**

No replacement cladding parts.
Skylight replacement only.

**FS A21****Mfg 01/2010 – Present**

Replacement cladding parts only
for frame cladding covers,
otherwise complete skylight
replacement.

Distinguishing features are
rounded glazing profile cladding
and light grey color.



FSF M87**Mfg 03/1987 – 02/1995**

No replacement cladding parts.
Skylight replacement only with
fixed or venting skylight.
Distinguished by exterior screws
through the top of the cladding
covers

**FSF M95****Mfg 03/1995 – 07/2007**

No replacement cladding parts.
Skylight replacement only with
fixed or venting skylight.

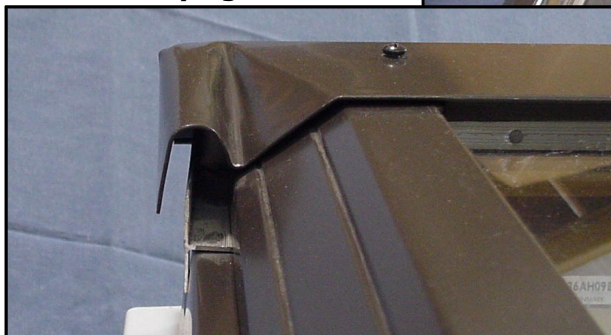


VS M84 / VS M87 / VSC**Mfg 02/1983 – 01/1996**

No replacement cladding parts.
Skylight replacement only.
Distinguished by exterior screws
through the top of the cladding
covers

**VS M96 / VS M96B****Mfg 02/1996 – 02/1998**

No replacement cladding parts.
Skylight replacement only.
Distinguished by no exterior
screws in the side and bottom
claddings and shape of top cladding
cover.

**VS M96B “flying Nun” cover****VS M98 / VS M01 / VS M03****Mfg 04/1998 – 04/2004**

No replacement cladding parts.
Skylight replacement only.

VSE M01
Mfg 02/2000 – 04/2004

VS / VSE H04
Mfg 05/2004 – 12/2009

No replacement cladding parts.
Skylight replacement only.

Distinguished by shape of top
cladding cover.



VS / VSE / VSS A21
Mfg 01/2010 – Present

Frame cladding parts available.
Sash complete required if sash
cladding damaged.

Distinguished by rounded sash
cladding and light grey color.

